


# PT1000R-2020-IX-DA91 Pressure Transmitter – With Current Output (2-Wire)

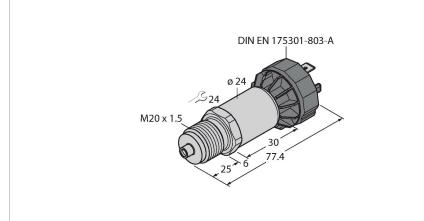


# Technical data

ID 1000 Pressure range	19846
Pressure range	
e e e e e e e e e e e e e e e e e e e	
Pressure type Relat	ive pressure
Pressure range 010	000 bar
014	4504 psi
010	D0 MPa
Admissible overpressure ≤ 150	00 bar
Burst pressure ≥ 250	00 bar
Response time < 2 m	ns, typ. 1 ms
Long-term stability 0.25	% FS, according to IEC EN 60770-1
Power supply	
Operating voltage 10	30 VDC
Current consumption ≤ 23	mA
Short-circuit/reverse polarity protection yes /	yes
Protection type and class IP65	/ 111
Insulation voltage 750	VDC
Outputs	
Output 1 Analo	og output
Output function Analo	og output current
Analog output	
Current output 420	) mA
Load ≤ (Su	pply voltage -10)/20 kΩ
Resolution <± 0.	1 % FS
Accuracy LHR ±0.3	% FS (typical; max. ±0.5 % FS)

# Features

- Fully welded metal measuring cell
- Pressure range 0...1000 bar rel.
- 10...30 VDC
- Analog output 4...20 mA
- Process connection M20 × 1.5 male thread, front sealing and manometer (combi)
- Connector device, DIN EN 175301-803-A
- ATEX, IECEx
- Category II 1/2 GD, Ex zone 0

## Wiring diagram

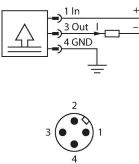

# Functional principle

The pressure sensors in the PT...-2000 product series operate with a fully welded metal measuring cell in various pressure ranges of up to -1...1000 bar in 2-, 3- or even 4-wire technology. Depending on the sensor variant, the processed signal is available as an analog output signal (4...20 mA, 0... 10 V, 0...5 V, 1...6 V, ratiometric) or as a digital IO-Link process parameter. The IO-Link sensor variants also have two independently configurable switching outputs. In addition to the standard variants, there are special sensors for uses such as ATEX areas

or for oxygen applications. A wide range of process connections and electrical connections offer a high degree of flexibility in a wide range of applications.




# Technical data

Temperature behaviour	
Medium temperature	-30+120 °C
Temperature coefficient	± 0.2 % of full scale/10 K
Environmental conditions	
Ambient temperature	-25+85 °C
Storage temperature	-50+100 °C
Vibration resistance	20 g, 152000 Hz, 1525 Hz with amplitude ± 15 mm, 1 octave/minute in all 3 directions, 50 continuous loads, acc. to IEC 68-2-6
Shock resistance	100 g, 11 ms, half sinusoidal curve, all 6 directions, free fall from 1 m onto con- crete (6x) acc. to IEC 68-2-27
Mechanical data	
Housing material	Stainless-steel/Plastic, 1.4404 (AISI 316L)/polyarylamide 50 % GF UL 94 V-0
Pressure connection material	Stainless steel 1.4404 (AISI 316L)
Pressure transducer material	Stainless steel 1.4435 (AISI 316L)
Process connection	M20 × 1.5 male thread, front sealing and manometer (combi)
Wrench size pressure connection / cou- pling nut	24
Electrical connection	Connector, DIN EN 175301-803 Form A
Max. tightening torque of housing nut	20 Nm
Reference conditions acc. to IEC 61298-1	
Temperature	15+25 °C
Atmospheric pressure	8601060 hPa abs.
Humidity	4575 % rel.
Auxiliary power	24 VDC
Tests/approvals	
Approvals	cULus
UL registration number	E302799
Important note	For intrinsically safe applications, the values specified in the correspond- ing Ex certificates (ATEX, IECEX, UL etc.) apply.
Ex approval acc. to conformity certificate	SEV 16 ATEX 0145
Application area	II 1/2 GD
Ignition protection category	Gas Ex ia IIC; dust Ex ia IIIC
MTTF	1189 years acc. to SN 29500 (Ed. 99) 40



## Accessories

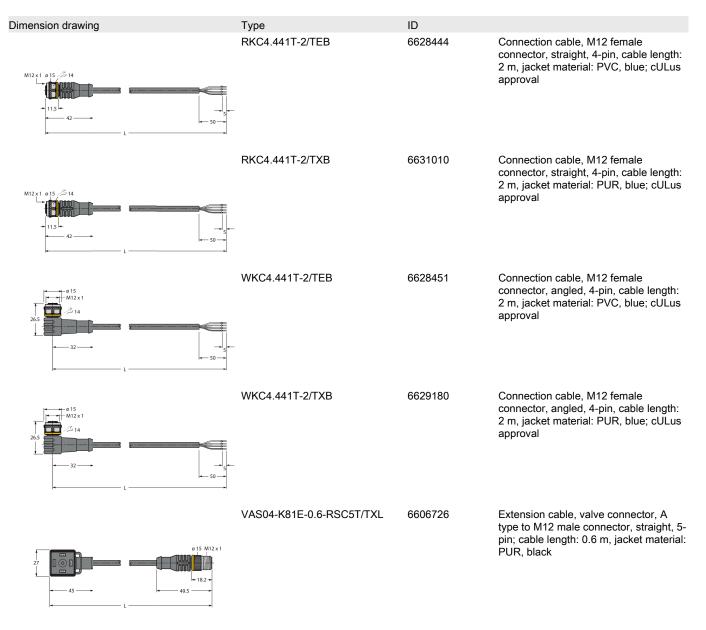



### Instructions for use

#### Intended use

This device fulfills Directive 2014/34/EU and is suited for use in areas exposed to explosion hazards according to EN 60079-0:2012 + A11:2013, EN 60079-11:2012 and EN 60079-26:2015. In order to ensure correct operation according to the intended purpose, the national regulations and directives must be observed.

For use in explosion hazardous areas conform to classification The sensors may be used only in dust or gas areas

#### Marking (see device or technical data sheet)

II 1/2 GD Ex ia IIC T4 Ga/Gb and Ex ia IIIC T125°C Da/Db acc. to EN60079-0:12+A11:2013

#### Installation/Commissioning

These devices may only be installed, connected and operated by trained and qualified staff. Qualified staff must have knowledge of protection classes, directives and regulations concerning electrical equipment designed for use in explosion hazardous areas.Please verify that the classification and the marking on the device comply with the actual application conditions.

This device is only suited for connection to approved Exi circuits according to EN 60079-0 and EN 60079-11. Please observe the maximum admissible electrical values. After connection to other circuits the sensor may no longer be used in Exi installations. When interconnected to (associated) electrical equipment, it is required to perform the "Proof of intrinsic safety" (EN60079-14).

#### Installation and mounting instructions

Avoid static charging of cables and plastic devices. Please only clean the device with a damp cloth. Do not install the device in a dust flow and avoid build-up of dust deposits on the device. If the devices and the cable could be subject to mechanical damage, they must be protected accordingly. They must also be shielded against strong electro-magnetic fields. The pin configuration and the electrical specifications can be taken from the device marking or the technical data sheet. In order to avoid contamination of the device, please remove possible blanking plugs of the cable glands or connectors only shortly before inserting the cable or opening the cable socket.

Special conditions for safe operation

The device must be protected against any kind of mechanical damage.

#### Service/Maintenance

Repairs are not possible. The approval expires if the device is repaired or modified by a person other than the manufacturer. The most important data from the approval are listed.